SUBMITTAL RECORD	
JOB	
LOCATION	
SUBMITTED TO	
SUBMITTAL PREPARED BY	
APPROVED BY	
DATE	



Submittal Form DADVP Vision Panel Insulated **Access Doors - Hinged**

DESCRIPTION Periodic inspection and testing of fire and smoke dampers and

detectors in ductwork is a standard safety procedure. Easy access to these devices as well as providing a means of removing dust accumulation can be provided by the installation of Vision Panel Hinged Access Doors from Duro Dyne. These doors incorporate an integral frame which readily fastens to the duct work as well as a camlock latching system for easy entry.

RELATED NFPA 90A & 90B STANDARDS

2-1.4 Duct Access and Inspection Provisions.

- 2-1.4.1 A service opening or telescoping or removable duct section shall be provided in ducts adjacent to each fire door, fire damper, smoke damper and smoke detector. The opening shall be large enough to permit maintenance and resetting of the device.
- 2-1.4.1 Service openings, telescoping or removable duct sections shall be identified with letters no less than 1/2 in. (1.27 cm) in height to indicate the location of the fire protection device(s) within.
- 2-1.4.3 Horizontal ducts and plenums shall be provided with service openings (see 2-1.4.1) to facilitate cleaning the duct of accumulations of dust and combustible materials. Service openings shall be placed at approximately 20 ft. (6.1-m) intervals along the duct and at the base of each vertical riser.
- Exception No. 1: Removable air outlet or air inlet devices of adequate size may be accepted in lieu of service openings.
- Exception No. 2: Service openings may be omitted in supply ducts when the supply air has previously passed through air filters or water spray.
- **Exception No. 3:** Service openings are not required when all the following conditions prevail:
- (a) The occupancy does not produce combustible material such as dust, lint, greasy vapors, etc. Such occupancies include banks, office buildings, churches, hotels, and health care facilities (but not kitchens, service rooms, and manufacturing portions of such facilities).
- **(b)** The air inlets are at least 7 ft. (2.13m) above the floor or are protected by corrosion-resistant metal screens of at least 14 mes, installed at the inlets so that they will not draw papers, refuse, cigarettes or other combustible solids into the return air duct.
- (c) The minimum design velocity in the return duct from the particular occupancy is 1,000 ft/min. (508m/sec.).

DUNG FAF

SUGGESTED SPECIFICATIONS

Service openings shall be provided in ducts adjacent to each fire door, fire damper, smoke damper and smoke detector. Horizontal ducts and plenums shall be provided with

service openings to facilitate cleaning the duct of accumulations of dust and combustible materials. Service openings shall be placed at approximately 20 foot intervals along the duct and at the base of each vertical riser. Service openings shall be sized and shall incorporate access doors coded as manufactured by Duro Dyne Corporation.

CONSTRUCTION

Door Frame: 24 ga. galvanized steel. Conforms to ASTMA 653. **Door Face:** 24 ga. galvanized steel. Conforms to ASTMA 653.


Insulation: 1" closed cell elastomeric foam - R value 4.2

Seals: Door to Frame/Frame to Door-Neoprene gasket. Conforms to ASTM-D 1056-68. Temperature range -20°F to 225°F .26 K Factor. Latches: Single Camlock action on all hinged doors 12" square and under. Dual latches on larger hinged sizes. Latches constructed of zinc plated cold rolled steel. Steel conforms to ASTMA-A-366.

Plating conforms to ASTMA-164-55. Hinge: Continuous Aluminum Piano Hinge. **Vision Panel:** .125 Plexiglass Vision Panel.

Item#	Code	Cut hole in duct	Vision Panel Size
1002	DADVP6x6	5-1/8" x 5-1/8"	3"x 3"
1003	DADVP8x8	7-1/8" x 7-1/8"	3"x 3"
1004	DADVP10x10	9-1/8" x 9-1/8"	3"x 3"
1005	DADVP12x12	11-1/8" x 11-1/8"	6" x 6"
1006	DADVP14x14	13-1/8" x 13-1/8"	6" x 6"
1007	DADVP16x16	15-1/8" x 15-1/8"	6" x 6"
1008	DADVP18x18	17-1/8" x 17-1/8"	6" x 6"
1009	DADVP20x20	19-1/8" x 19-1/8"	6" x 6"
1010	DADVP24x24	23-1/8" x 23-1/8"	6" x 6"

Cam Lock only also available, code DADVPC. Stainless Steel and Aluminum available upon request.

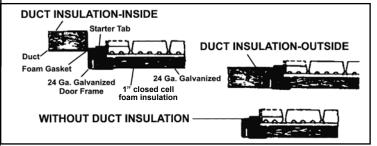

Duro Dyne Corporate Headquarters 631-249-9000 Fax: 631-249-8346

Duro Dvne Midwest • Duro Dvne West • Duro Dvne Canada www.durodyne.com E-mail: durodyne@durodyne.com

